

JDSU HST-3000C CX-VBONDED-WB2 Specs Provided by www.AAATesters.com HST-3000 Handheld Services Tester

Broadcom[®] Bonded ADSL2+/VDSL2 SIM



- **Key Benefits** Saves money and reduces repeat faults with triple-play services testing capability
 - One universal module covers VDSL2/ADSL2 single and bonded pair with vectoring
 - Saves time—the same tip/A, ring/B leads test copper and xDSL
 - Verifies critical correct pair-bonding and provisioning, letting users segment single-line performance issues for bonded groups
 - Isolates faults stemming from bridged taps, noise, or poor pair balance using Hlog and QLN graphs and G.INP analysis
 - Improves OpEx and field productivity when combined with StrataSyncTM, a cloud-based solution that displays assets, modules, versions, and locations; maintains accurate instrument configuration and setup; and provides visibility into instrument utilization and test data management

Applications

- ADSL2+, VDSL2, ADSL2+/ VDSL2 bonding and VDSL2 vectoring
- Triple-play services over ADSL2+, VDSL2, Ethernet, and WiFi (web, data throughput, IP video, VoIP)
- Advanced copper-circuit testing with precision fault location
- Optical power level testing (with MP-60 or MP-80 USB accessory)

Service providers face significant challenges when ramping up their networks to provide advanced triple-play services with the same or better quality than cable/ multiple switch operators (MSOs). Key to their success is cost-effectively increasing bandwidth to subscribers for new IP video services over bonded asymmetric digital subscriber line 2+/very high-speed digital subscriber line 2 (ADSL2+/VDSL2). Internet Protocol television (IPTV) services require pristine xDSL service Layer 1 performance. Factors such as noise, crosstalk, pair imbalance, bridged taps, and other copper plant anomalies can be easily hidden when testing one pair at a time. Designed for the outside plant, the HST-3000 meets those challenges head-on.

Featuring the latest Broadcom Corporation chipset, the new service interface module (SIM) tests bonded-pair ADSL2+/VDSL2 by terminating both pairs of a bonded group. The Broadcom SIM also supports legacy ADSL1, ADSL2, ADSL2+, VDSL2, and vectored VDSL2 in the same module, so technicians can easily switch between testing bonded and non-bonded services without the need to swap modules. Further, the module lets technicians work smarter and faster to test copper and xDSL using the same dual tip/ring/ground interface leads for both service turn-up and copper fault isolation.

The lightweight, rugged, and battery-operated HST-3000 with the Broadcom SIM costeffectively scales to provide an all-in-one solution for field installation, maintenance, and troubleshooting across a wide range of triple-play service test applications.



Figure 1. Bonded pair testing is mission critical

Applications

Why a Bonded Pair Test?

A relatively simple, single-pair sync test that checks one xDSL pair at a time is simply insufficient for bonded pair DSL service. Testing one pair at a time will not establish actual line rates, because it does not include the impact of crosstalk. Rates may give a false positive, because they may show higher bit rates without the effects of crosstalk noise. Testing one line at a time will not exercise the pair-bonding timer threshold settings nor will it validate that each line is wired to or configured for the same bonding group.

- Identifying when loops are not in the same bonding group *requires* dual modem testing
- Proper provisioning and bonded group metrics analysis require *both* interfaces to be active
- · Crosstalk analysis is only possible when both pairs are active

Full Compatibility Range

The new universal xDSL SIM for the HST-3000 tests ADSL1, ADSL2, ADSL2+, VDSL2, bonded ADSL, bonded VDSL, and vectored VDSL2 with just one module, making it compatible with a huge range of CPE and DSL access multiplexer (DSLAM) equipment. Service providers can minimize their investment cost in test equipment as well as in DSLAM ports, so they can continue to offer high-speed data services over single-pair ADSL2+, while turning up new IP video service tiers as they qualify new bonded service areas.


| | UP | DOWN |
|----------------|---------|----------|
| Group Rate | 94675 K | 160064 K |
| Max Group Rate | 94072 K | 246918 K |
| Group Capacity | 100.0 % | 64.8 % |
| Lapse Time | 0 sec | |
| DSL Interface | RJ45 | |

Figure 2. Show Time for bonded pairs requires that both pairs of a bonded group are active

| 🐼 VDSL Summary - Pair 1 👘 🐔 🐔 | | | |
|-------------------------------|---------|---------|---------------|
| HOME->VDSL BOND->E | | | un data estas |
| | Est. | | Data Off |
| | ength | V-FI | VDSL2 17a |
| | I.3k ft | F | U45, VTU-R |
| V-Full/Show Ti | me | UP | DOWN |
| Actual Rate | 506 | 28 K | 80032 K |
| Max Rate | 503 | 41 K | 122519 K |
| Capacity | 100 | 0.0 % | 65.3 % |
| Noise Margin | Ş | 9.4 dB | 14.1 dB |
| Line Attenuation | 17 | 7.7 dB | 11.0 dB |
| Signal Attenuation | 17 | 7.2 dB | 11.0 dB |
| Display 🔺 SELT TERI | vi Res | sults 🔺 | DSL Stop |

Figure 3. View statistics simultaneously for both pairs of a bonded group

Technicians can analyze poorly performing services with bits-per-tone (BPT), Hlog (insertion loss), and quiet line noise (QLN) graphs accessible within the xDSL application. Significant dips or notches in the BPT and Hlog graph may indicate the presence of a bridged tap or a corroded splice, showing the absorption of DSL signal energy. The QLN graph provides an indication of external noise interference. Spikes may show a high noise floor revealing noise interference issues. After identifying the trouble source, technicians can find and correct problems with the advanced copper measurement suite on the HST-3000, including the precision time domain reflectometer (TDR) or resistive fault locator (RFL) tools.

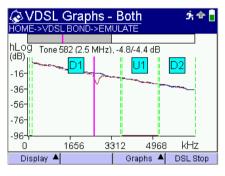

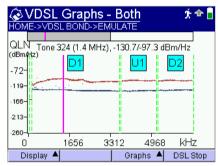



Figure 4. Dual-pair Hlog graph showing likely bridged tap on pair 1 at tone 582

Figure 5. Dual-pair QLN graph showing noise on pair 1

StrataSync Empowers Your Assets

StrataSync[™] ENABLED

StrataSync is a hosted, cloud-based solution that manages assets, configurations, and test data for JDSU instruments and ensures that all instruments are equipped with the latest software and installed options. StrataSync manages inventory, test results, and performance data from anywhere with browser-based ease for improved technician and instrument efficiency. StrataSync manages and tracks test instruments, collects and analyzes results from the entire network, and informs and trains the workforce.

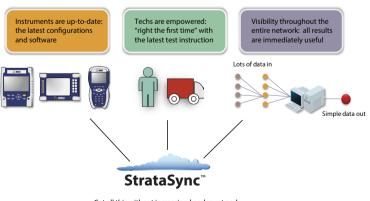

Get all this without increasing headcount and while minimizing overall operating costs and truck rolls.



Specifications

DSL Modem

Test Interface

ADSL2+/VDSL2, RJ45 (single and bonded) ADSL2+/VDSL2, 2 mm recessed banana tip/A, ring/B, (single and bonded)

Modem Chipset

Broadcom 63168

VDSL Standard Compliance ITU-T-G.993.2 VDSL2 Annex A, B

ITU-T-G.998.1 ATM bonding ITU-T-G.998.2 PTM bonding ITU-T-G.993.5 self-FEXT cancellation (vectoring) Profiles: 8a/8b/8c/8d, 12a/12b, (17a for single only) Band plan 997 and 998, UO band

ADSL Standard Compliance ITU-T G.992.1

| Annex A (G.DMT) |
|--|
| ITU-T G.992.3 Annex A, L (ADSL2) |
| ITU-T G.992.5 Annex A, M (ADSL2+) |
| ITU-T-G.998.1 ATM bonding |
| ITU-T-G.998.2 PTM bonding |
| ANSI T1.413-1998, Issue 2 |
| ITU-T G.992.5 INP Amendment 3 |
| All Modes (single, bonded pair ADSL/VDSL2) |
| Graphs |
| BPT |
| Combination BPT/SNR tone |
| VDSL band statistics |
| Hlog |
| QLN |
| Miscellaneous results |
| Synchronization (Show Time) |
| Failed synchronization |
| Number of syncs |
| Training time |
| Standard used |
| Estimated loop length |
| Modem firmware version |
| Errors/Performance Local/Remote/Remote (total) |
| Loss of signal |
| Forward error correction (FEC) |
| Cyclic redundancy check (CRC) |
| Loss of frame |
| Loss of margin |
| Far end loss of signal |
| Errored seconds |
| Severely errored seconds |
| Unavailable seconds |
| Measurements (bonded pair ADSL/VDSL2) |
| G.INP Statistics (upstream/downstream) |
| Status |

Status

Retransmitted DTUs Corrected DTUs **Uncorrected DTUs**

INP REIN

Measurements (upstream/downstream) Modem state

Group rate Max group rate Group capacity Lapse time Per Band Bonded VDSL2 Statistics Loop attenuation (LATN) Signal attenuation (SATN) SNR margin Tx power Vectoring Status V-not configured, V-running, V-full, F-friendly

Network

Network Modes Terminate, through **Network Types** ADSL1, ADSL2, ADSL2+, VDSL, bonded ADSL2+, bonded VDSL

IPoE, PPPoE, IPv6oE, multiple VLANS, data off ADSL/ADSI2+ IPoE, PPPoE, IPv6oE, MVC Video, IPoA, PPPoA, multiple VLANS, Network off VPI/VCI **Transport Types** ATM, PTM IP Mode DHCP, static **MAC Setting** Factory default, user-defined Vendor Id Yes/No User Class Yes/No

VLAN Tag on/off

ID selection 0-4095 Priority selection 0-7

Additional Features

Technology auto mode for single pair DSL standard (Auto, ADSL, VDSL2) Transport auto mode (ATM or PTM bonding) PhyR settings upstream/downstream NitroMode Dual latency paths (VDSL2) Four latency paths (ADSL2/2+)

Cables

CB-5CLIP-BON RJ to 5-clip lead cable (bonded cable for Broadcom/Conexant®/Capri SIMs) CB-5CLIP-RTC RJ to 5 clip lead cable with regular telco clips (bonded cable for Broadcom/Conexant/Capri SIMs) CB-BONDED RJ to dual RJ cable (bonded cable for testing at the NID/NIU)

Ordering Information

Base Unit

| HST3000-NG2-1 | HST-3000 mainframe without copper (color) |
|----------------|---|
| HST3000C-NG2-1 | HST-3000 copper mainframe (color) |
| | |

Available SIMS (modules)

| | · / |
|---------------------|--|
| HST3000-BDCM-2 | ADSL/VDSL with Broadcom chipset |
| HST3000-BDCM-WB2- | 2 ADSL/VDSL bonded and copper (up |
| | to 30 MHz) with Broadcom chipset |
| HST3000-CUCE | Copper only SIM, CE marked |
| HST3000-WB2 | Wide band 2 (up to 30 MHz) copper test |
| HST3000-ETH | 10/100/1000 Ethernet |
| HST3000-CT1 | T1 and copper |
| HST3000-DC | Datacom |
| HST3000-E1 | E1 |
| HST3000-E1-DC | E1/datacom |
| HST3000-4WLL | 4-wire local loop |
| HST3000-T1 | Dual TX/RX Bantam T1 interface and T1 |
| HST3000-T3 | Dual TX/RX Bantam T1 interface, |
| and dual | RX/single TX BNC DS3 interface/and DS3 |
| HST-BRA ETSI (Euro) | ISDN BRA |
| HST3000-BRI | ISDN BRI |
| HST3000-CSH4 | Copper, 4-wire G.SHDSL |
| | (STU-R/C, Annex A/B) |
| HST3000-BLK | Blank |

Software Options

| Bluetooth wireless |
|--|
| Class of service |
| 802.11 wireless |
| Web browser |
| Remote operation |
| Scripted test |
| ADSL2 and ADSL2+ |
| Advanced IP suite—PING and |
| through mode support |
| IP video analysis |
| Video MOS analysis |
| Microsoft IPTV video analysis |
| VT100 emulation |
| VoIP software analysis |
| H.323 VoIP signaling |
| SCCP MGCP VolP signaling |
| VoIP mean opinion score |
| SCCP VoIP signaling |
| VoIP signaling |
| VoIP signaling call controls for UNISTIM |
| Optical Ethernet |
| IPv6 option for Ethernet SIM |
| MPLS |
| Multiple streams |
| TCP/UDP |
| FTP |
| WB TIMS |
| |

Test & Measurement Regional Sales

| NORTH AMERICA | LATIN AMERICA | ASIA PACIFIC | EMEA | WEBSITE: www.jdsu.com/test |
|---------------------------|----------------------|---------------------|-----------------------|----------------------------|
| TOLL FREE: 1 855 ASK-JDSU | TEL: +1 954 688 5660 | TEL: +852 2892 0990 | TEL: +49 7121 86 2222 | |
| (1 855 275-5378) | FAX: +1 954 345 4668 | FAX: +852 2892 0770 | FAX: +49 7121 86 1222 | |